




#### **Industrial Upright Assembly**

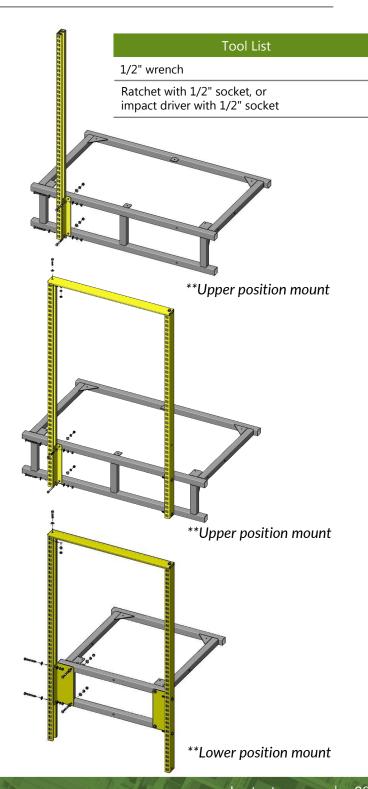

#### Part # SUP53 - Single Slotted Upright

Item	Components*	Qty
Α	53" Slotted upright	1
С	Upright mounting bracket	1
D	5/16-18 x 2 1/2" Hex head cap screw	4
F	5/16-18 Hex nut	4
G	5/16" Flat washer	8
Н	5/16" Lock washer	4

#### Part # SBUP53 - Single Bay Slotted Uprights

Item	Components*	Qty
Α	53" Slotted upright	2
В	30" Top cross bar	1
С	Upright mounting brackets	2
D	5/16-18 x 2 1/2" Hex head cap screw	8
E	5/16-18 x 1 1/2" Hex head cap screw	2
F	5/16-18 Hex nut	10
G	5/16" Flat washer	18
Н	5/16" Lock washer	10

## Part # SBUP53-30 - Single Bay Slotted Uprights for 30" Workstations


Item	Components*	Qty
Α	53" Slotted upright	2
В	30" Top cross bar	1
С	Upright mounting brackets	2
D	5/16-18 x 2 1/2" Hex head cap screw	8
Е	5/16-18 x 1 1/2" Hex head cap screw	2
F	5/16-18 Hex nut	10
G	5/16" Flat washer	18
Н	5/16" Lock washer	10

<sup>\*</sup>Extra hardware may be included





#### **Industrial Upright Assembly**

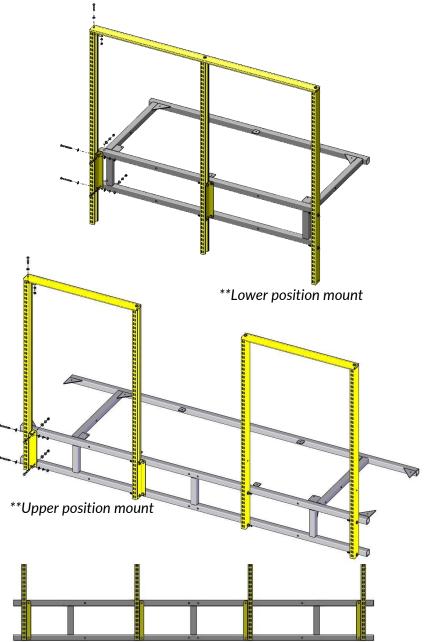

Part # DBUP53 - Double Bay Slotted Uprights

Item	Components*	Qty
Α	53" Slotted upright	3
В	60" Top cross bar	1
С	Upright mounting brackets	3
C-TC	Outer upright mounting brackets for 60"w technical workstations only	2
D	5/16-18 x 2 1/2" Hex head cap screw	12
Е	5/16-18 x 1 1/2" Hex head cap screw	3
F	5/16-18 Hex nut	15
G	5/16" Flat washer	27
Н	5/16" Lock washer	15

Part # TBUP53 - Triple Bay Slotted Uprights

Item	Components*	Qty
Α	53" Slotted upright	4
В	30" Top cross bar	2
С	Upright mounting brackets	4
D	5/16-18 x 2 1/2" Hex head cap screw	16
Е	5/16-18 x 1 1/2" Hex head cap screw	4
F	5/16-18 Hex nut	20
G	5/16" Flat washer	36
Н	5/16" Lock washer	20

<sup>\*</sup>Extra hardware may be included

Select the mounting holes on the rear deck frame as illustrated on page 4.


\*\*All industrial uprights can mount 33" (lower position) or 42" (upper position) above work surface.

TBUP53 bracket placement




#### **Industrial Upright Assembly**

2 Mount the upright brackets (C) to rear of table using the 5/16-18 x 2 1/2" hex head cap screws (D), 5/16" flat washers (G), 5/16" lock washer (H) and 5/16-18 hex nuts (F) (Fig-1) See Fig-2 and Fig-3 for mounting outer brackets on a 60"w technical workstation

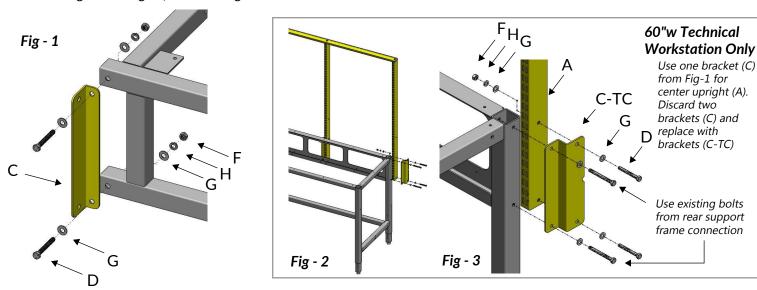

- Position the uprights (A) with utility channel (Fig-4) facing the upright mounting brackets (C). Mount using the 5/16-18 x 2 1/2" hex head cap screws (D), 5/16" flat washers (G), 5/16" lock washers (H) and 5/16-18 hex nuts (F).
  - Utility channel does not face the outer brackets on a 60"w technical workstation (Fig-3)
- 4 Mount the top cross bar (B) to the uprights (A) using the  $5/16-18 \times 11/2$ " hex head cap screw (E), 5/16" flat washers (G), 5/16" lock washer (H) and 5/16-18 hex nuts (F) (Fig-5)

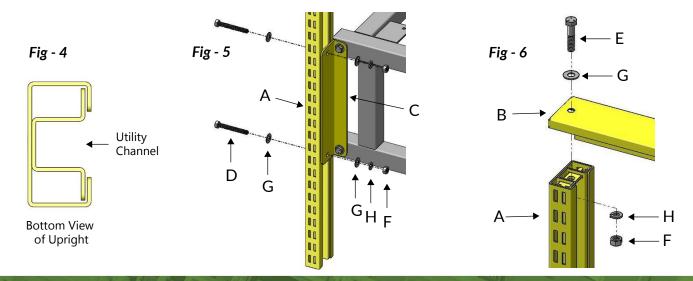






# Optional Upright Mounting Positions

 
Industrial workstations are pre-drilled on the rear deck frame for multiple upright mounting positions. These photos show mounting options and bracket placement on the back of workstation. **SBUP53** mounting position for 36"w and 48"w workstations. Uprights shown on 48"w workstation.




**SBUP53** optional mounting positions for 60"w, 72"w and 84"w workstations. Uprights shown on 60"w workstation.

**DBUP53** mounting position for 60"w, 72"w and 84"w workstations. Uprights shown on 60"w workstation.



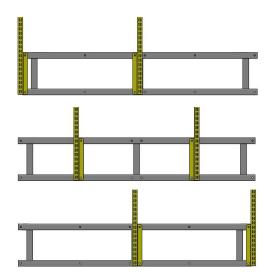

DBUP53 optional mounting positions for 96"w workstation

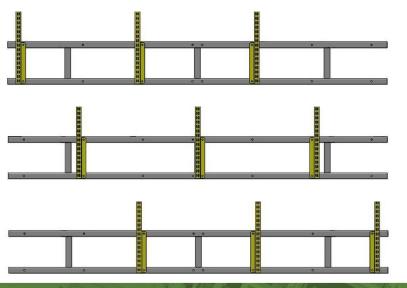

SBUP53 optional mounting positions for 96"w workstation

