

## CALIBRATION OF THE PS-500

A minimum 10% of scale capacity is needed in order to calibrate the scale. To escape or abort calibration at any time press the ZERO/ON/OFF button.

1. Turn on the scale. The indicator goes thru display test. When it becomes stable, we are ready to calibrate the scale. With no weight on the scale.
2. Press the **TARE** and the **ZERO/OFF/ON** buttons at the same time and hold until the display shows CAL.-?, then release both buttons.
3. Press the **TARE** button, the display will show the maximum capacity of the scale, follow by CAL.P0 and then 0.0 with the last digit flashing.
4. Press the **TARE** button, the display will flash and show CAP.P1, you will need to key in a calibration weigh of 50lbs. minimum or the calibration weight that you have. (A minimum 10% of scale capacity is needed in order to calibrate the scale.) **Place the weight on the scale**; and key in your calibration weight from right to left by using the **UNIT** key to scroll your numbers up/down and use the **HOLD/PRINT** key to advance you to the left to enter your next number. Do this until the last digit on the left is flashing.
5. Press the **TARE** button, the display will flash and display CAP.P2, with calibration weight still on the scale. You will need to re-enter in your calibration weight from right to left, using the same procedure in STEP 4.
6. Press the **TARE** button, the display will flash and display CAP.P0. **Remove all weight from the scale.**
7. Press the **TARE** button, the display will flash 0.0 and go back to the weigh mode.
8. Your scale is calibrated and should weigh correctly. If error message CAL.Er appears repeat the procedure again.