

TECHNICAL BULLETIN

IMPORTANT PRODUCT INFORMATION


► Clevlok Load Pin Retention Issue

Effective May 2022

Reason for Bulletin

We have discovered a problem with the load pin retention on 9/32" G80 and G80/100 Clevlok products with roll pin type retaining plugs. Some of these sourced components are undersized. Load pins may fall out during normal operation.

Use of products with these retainers may result in serious personal injury or property damage.

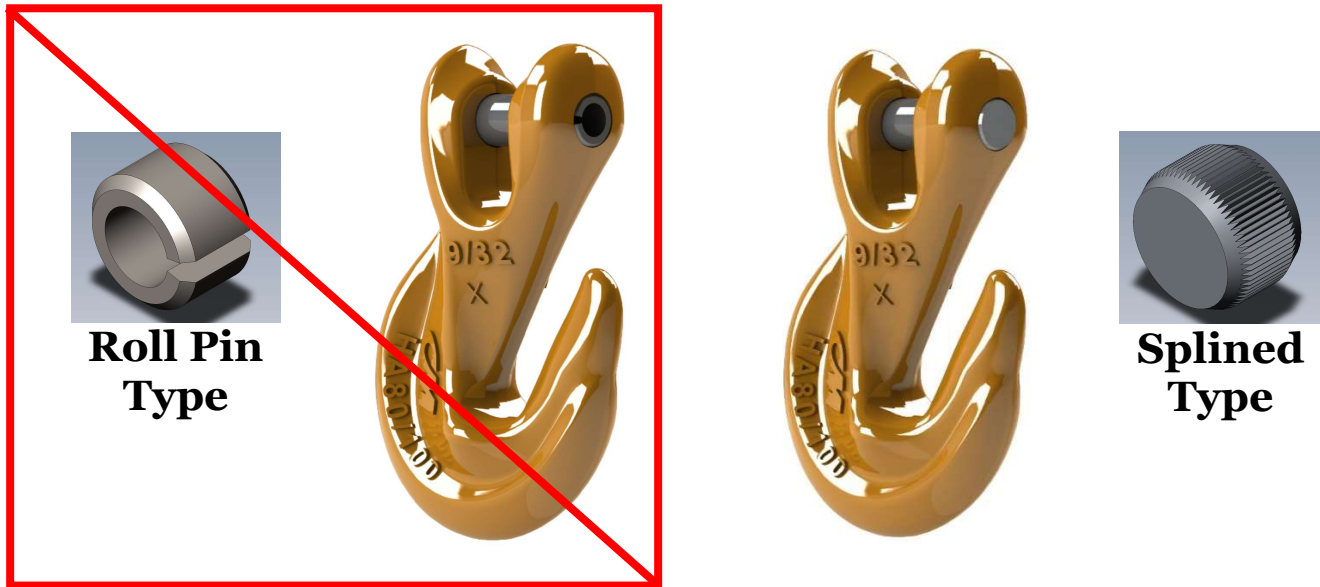

To avoid injury:

- Immediately remove all 9/32" G80 and G80/100 Clevlok products with roll pin type retaining plugs (PN 495831) from service.
- Replace roll pin type retaining plugs (PN 495831) with CMCO supplied solid knurled type retaining plug (PN 495834).

WARNING: Neither roll pin type plugs or splined type plugs should be used in hooks with cross drilled retaining pin holes.

